CAPE TOWN APP CON
119.7

Max 250 KIAS within 30 DME of CTV below FL200. If unable to comply, advise ATC.

If unable to comply with STAR, notify ATC.

Applicable only when surveillance radar in operation.

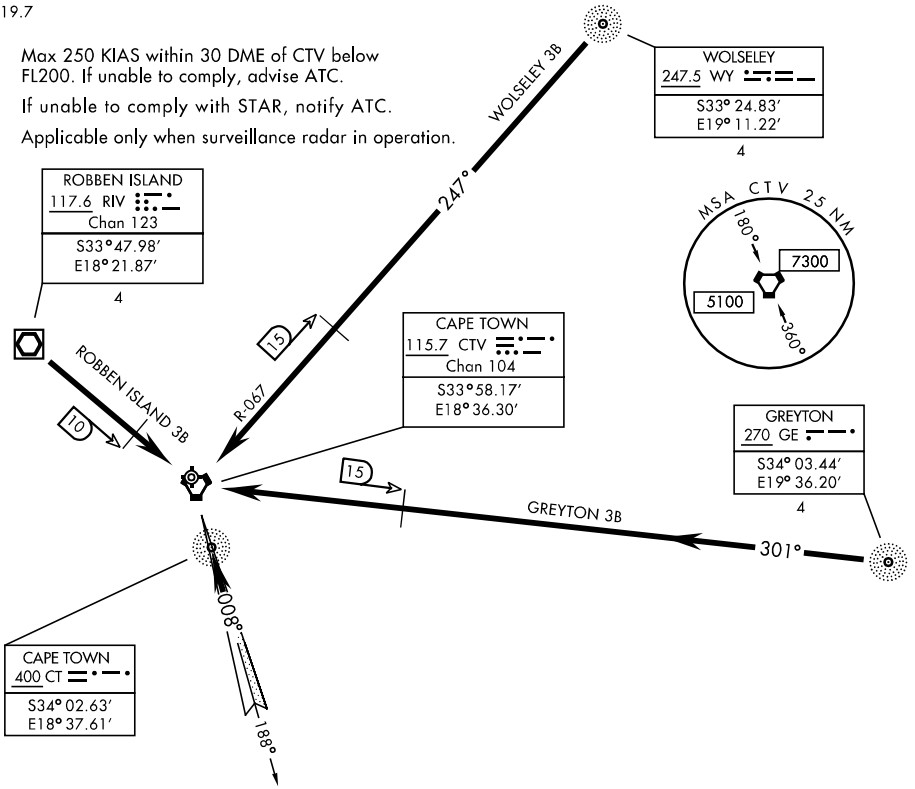

RADIO COMMUNICATION FAILURE:

WOLSELEY 3B RWY 01 (Before WY): Maintain last assigned level, proceed direct WY, intercept CTV R-067 to CTV. (At CTV 15 DME): descend to FL100. At CTV complete the VOR/DME/ILS approach and land Rwy 01. (After WY): Maintain last assigned level direct to CTV. At CTV complete the VOR/DME/ILS approach and land Rwy 01. (Inside CTV 10 DME): Maintain last assigned level or climb to 3000, whichever is higher. Turn right direct CTV. Complete the VOR/DME/ILS approach and land Rwy 01. NOTE: In the event of radio communication failure within 10 DME of CTV on the WOLSELEY 3B Arrival, do not cross CTV R-200 or proceed south of CTV 14 DME.

GREYTON 3B RWY 01 (Before GE): Maintain last assigned level and continue with GREYTON 3B Arrival. At CTV 15 DME proceed direct to CTV and descend to FL100. At CTV complete the VOR/DME/ILS approach and land Rwy 01. (After GE, outside of CTV 15 DME): maintain last assigned level and continue with GREYTON 3B Arrival. At CTV 15 DME proceed direct to CTV. At CTV complete the VOR/DME/ILS approach and land Rwy 01. (Inside CTV 15 DME): Maintain last assigned level or climb to 3000, whichever is higher. Turn right direct to CTV. Complete the VOR/DME/ILS approach and land Rwy 01. NOTE: In the event of radio communication failure within 10 DME of CTV on the GREYTON 3B Arrival, do not cross CTV R-200, or proceed south of CTV 14 DME.

ROBBEN ISLAND 3B RWY 01 (Before RIV): Maintain last assigned level or climb to 6500, whichever is higher. Continue with ROBBEN ISLAND 3B Arrival. At RIV 10 DME (outbound) descend to 6500, if higher, direct to CTV and continue with VOR/DME/ILS procedure and land Rwy 01. (After RIV): Maintain last assigned level or climb to 6500, whichever is higher and continue with ROBBEN ISLAND 3B Arrival. At CTV 15 DME (south), turn left direct CTV. At CTV complete the VOR/DME/ILS procedure and land Rwy 01. NOTE: Do not cross CTV R-181.

MISSED APPROACH: For diversions, proceed via following SID:
- To the northeast - OVALA 3A
- To the east - ERBER 3A

Effective 28 Nov 2002 - 26 Dec 2002